

Date: Tuesday, 07/04/2009 3:19:50 PM  
 User: Julie Dawson

## Process Sheet

<b>Customer</b> :	CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b> :	MID TUBE ASSEMBLY
<b>Job Number</b> :	47066		
<b>Estimate Number</b> :	10469		
<b>P.O. Number</b> :		<b>Part Number</b> :	D3391023
<b>This Issue</b> :	07/04/2009	<b>S.O. No.</b> :	
<b>Prsht Rev.</b> :	NC	<b>Drawing Number</b> :	D3391 REV H
<b>First Issue</b> :	/ /	<b>Project Number</b> :	N/A
<b>Previous Run</b> :	47065	<b>Drawing Revision</b> :	H
<b>Written By</b> :		<b>Material</b> :	
<b>Checked &amp; Approved By</b> :	<u>Julie Dawson</u>	<b>Due Date</b> :	27/04/2009
<b>Comment</b> :	Est. A 05.10.20 New Issue KJ/EC Est. B 06.02.10 ECN773 dwg rev.D EC est C 07.03.20 rev F dwg EC est D 07.03.28 re-format EC est E 07.10.31 ecn 1053P EC Est Rev:F ECN 1056 07-11-13 DD verified by: EC Est Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC Est Rev:H 08-09-10 revH as per dwg DD verified by:EC Est Rev:I 08-11-13 Removed steps per w/o, QC KJ verified by: ec		
		<b>Qty:</b>	1 <b>Um:</b> Each

## Additional Product

Job Number:



<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>
----------------	------------------------------	----------------------

1.0	D25001100	Skidtube Extrusion
-----	-----------	--------------------



**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

SKIDTUBE EXTRUSION

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-100	Extrusion	B245923

9-4-15

2.0	D3391021	Fwd Tube Assembly
-----	----------	-------------------



**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Fwd Tube Assembly

Batch: 46921

D 11 9-4-30

3.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------



**Comment:** LANDING GEAR RESOURCE 1

1-Cut tube to finish length as per Dwg D3391

2-Identify as D3391-023

3-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only, as

9-4-15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Tuesday, 07/04/2009 3:19:51 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 47066

Part Number: D3391023

Job Number:



Seq. #:

Machine Or Operation:

Description :

per Dwg D3391

4-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

5-Remove .030" from Fwd indexing Ridge as per Dwg D3391

6-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391

7-Deburr

8-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker,

9-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (14 holes) as per Dwg D3391 and 2 holes in section Detail "J", do not open wearplate holes of section "J"

10-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391

11-Open .375" holes to .438" \*\*\*do not open fwd saddle holes\*\*\*

12-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

13- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021

14- Transfer drill 2 wearplate holes into D3391-021 using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.

15- Locating from two fwd wearplate holes drillol remaining 6 wearplte holes in D3391-021 using DT8937

16- Open 2 fwd wearplate holes in D3391-023 to .250" dia.

17- counterbore two aft wearplate holes in D3391-021 as per dwg

18- Open 12 wearplate holes in D3391-021 to 0.297" dia.

19-Deburr and blow out all chips from inside tube

4.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

809107108 (40)

**Dart Aerospace Ltd**

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Tuesday, 07/04/2009 3:19:51 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 47066

Part Number: D3391023

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

*pm 09-05-11 (1)*

6.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*BE 09-05-11*

7.0

D33891

Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEB

Pick:

Qty

Part Number

Description

Batch

1

D3389-1

Web

*B47303*

A/R

Sikaflex-241/-291

*m111081*

Sikaflex expire date:

*10-01-20*

*pm 09-05-11 (1)*

Start: *09-05-11* Time: *11:00*

Finish: *09-05-12* Time: *7:00*

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open float bag holes as per dwg to 0.313"  $\pm$

2-C'sink float bag holes as per dwg

3- Prepare tube for welding

4-Bond web in place as per Dwg D3391 & QSI 015.

Adhere for 12 hours)

*pm 09-05-11 (1)*

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*BE 09-05-12*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Tuesday, 07/04/2009 3:19:51 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 47066

Part Number: D3391023

Job Number:



Seq. #: Machine Or Operation: Description :

10.0

D36811

Spacer



Comment: Qty.: 5.0000 Each(s)/Unit Total: 5.0000 Each(s)

SPACER

batch:

*B47123 BE 09/05/12*

11.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Weld crossbolt spacer as per dwg D3391 & QSI 004

2-grind weld flush

*BE 09/05/12*  
*u 9-5-12*

12.0

QC10

VISUAL INSPECTION OF GROUND WELDS



Comment: VISUAL INSPECTION OF GROUND WELDS

*8 09/05/12 (X)*

13.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*8 09/05/12 (X)*

14.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

*M111472*  
*Pressure Wash*

*MD 09/05/20*

START TIME:

*3:30*

OVEN TEMPERATURE:

*300°*

FINISH TIME:

*8:00*

*MD 09/05/21*

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*09-05-21 (X)*

16.0

D35911

Bushing



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bushing

*B413172*

*911*

*09-05-21 (X)*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Tuesday, 07/04/2009 3:19:51 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 47066

Part Number: D3391023

Job Number:



Seq. #:

Machine Or Operation:

Description :

17.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: SKIDTUBESS RESOURCE 1

1- insert D3391-021 into D3391-23

2- insert T-pins into first and third fwd saddle holes

3- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per DSI 9364

4- remove T-pins and locate DT9415 from first and third crossbolt hole using T-pins and clekos

5- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499". Remove DT9415

6- deburr, re-alodine and blow out chips

7- press fit D3591-1 spacers using DT9416 starting from 0.500" side

JP 09-05-21 (X)

18.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/05/01 (X)

19.0

ALS41032130

Insert



Comment: Qty.: 22.0000 Each(s)/Unit Total : 22.0000 Each(s)

INSERT

batch: M110511

or equivalent

x per QSI 017

JP

20.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install Inserts as per Dwg

JP

09-05-21 (X)

21.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/05/01 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Tuesday, 07/04/2009 3:19:51 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: MID TUBE ASSEMBLY

Job Number: 47066

Part Number: D3391023

Job Number:



Seq. #:

Machine Or Operation:

Description :

22.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: \_\_\_\_\_

PPD46805

8/5/05/22 @

23.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

09/05/2005

Job Completion



U 09.05.22


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

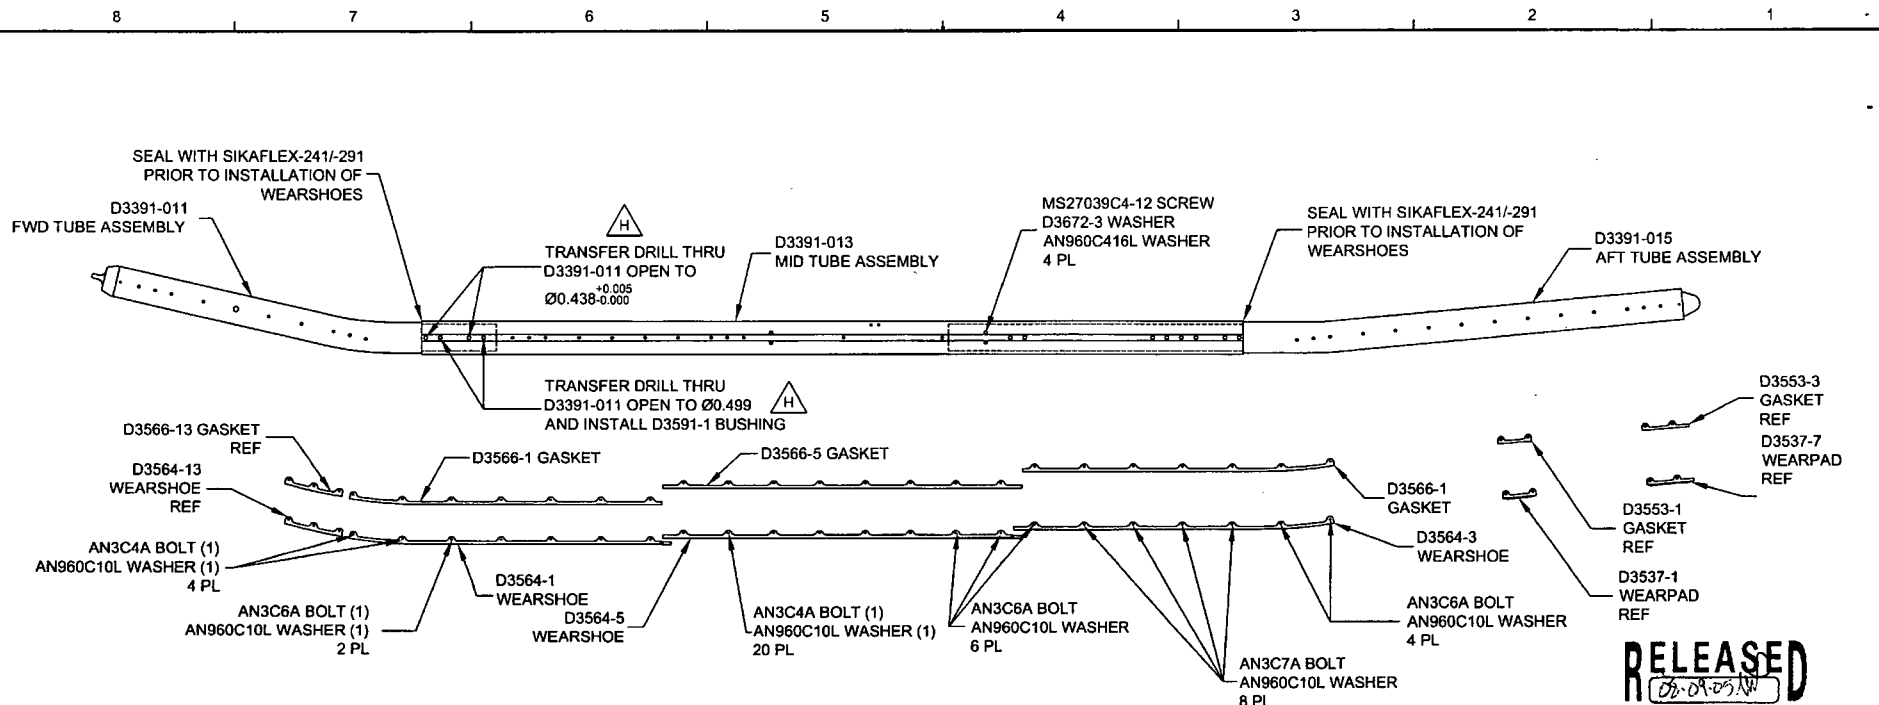

**D3391-041 ASSEMBLY**

**D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**


QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3591-1	BUSHING
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
4	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER


**GENERAL NOTES**

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH  
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH  
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS  
OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø.297 SIZE HOLES  
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT  
WHERE INDICATED.


H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 Ø.438 DIM WAS 4 PL. ADDED Ø.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 Ø.438 DIM WAS 4 PL. ADDED Ø.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

NO. 1170000  
WORK ORDER  
WITHOUT NOTICE  
UNCONTROLLED COPY  
RETURN TO  
ENGINEERING  
SHOP COPY  
RETURN TO

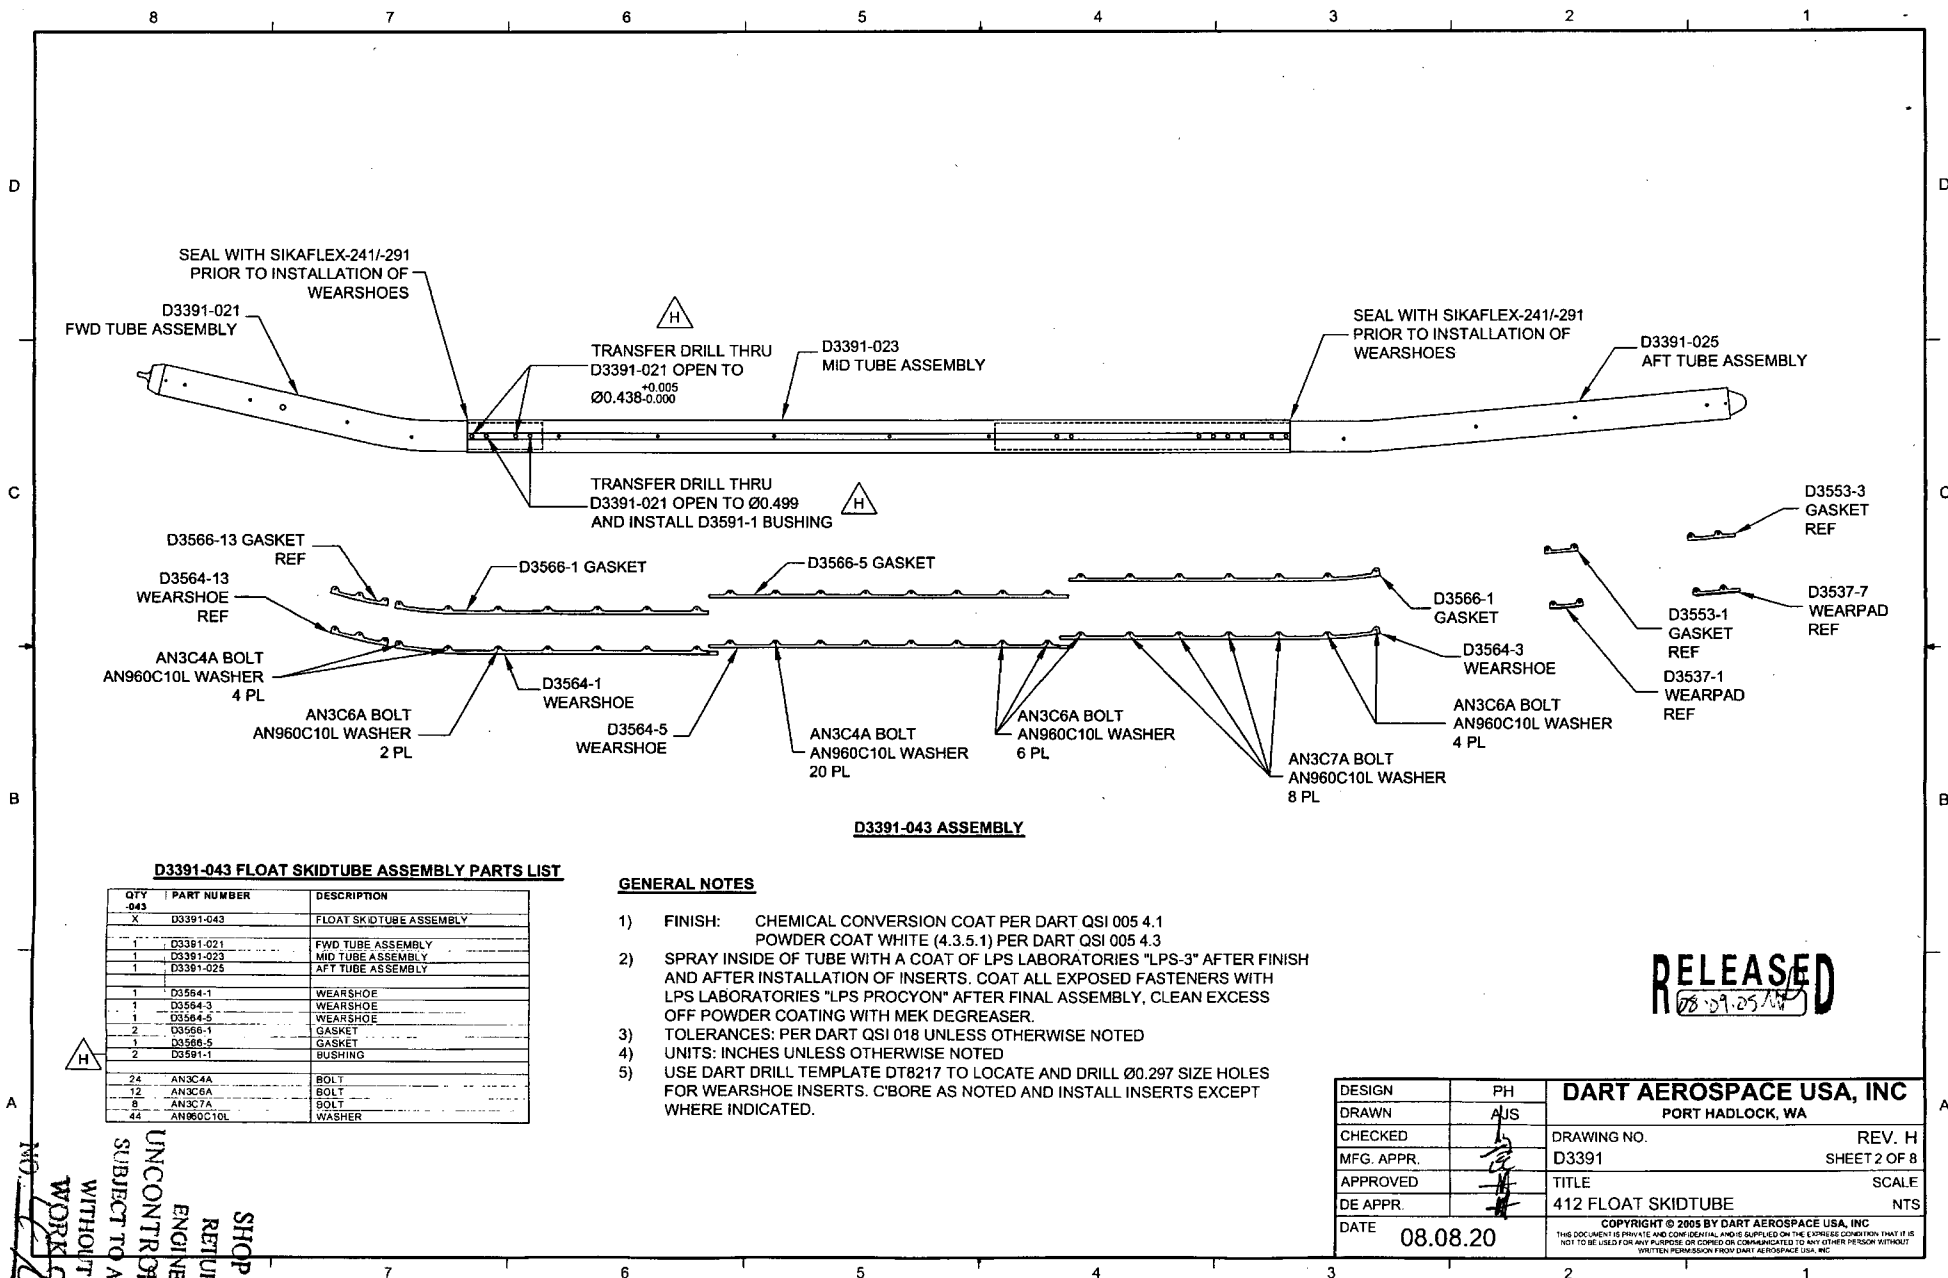


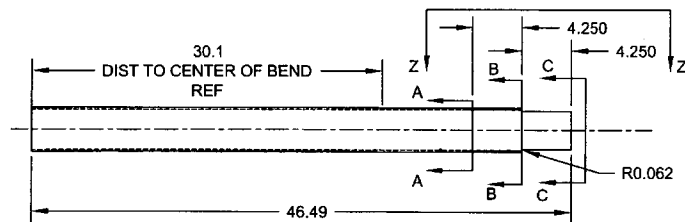


**D3391-1 CUTTING DETAIL**  
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

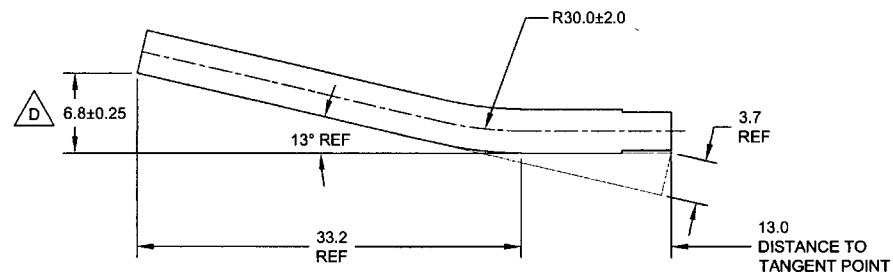


**D3391-011/-021 BENDING DETAIL**  
(MAKE FROM D3391-1)

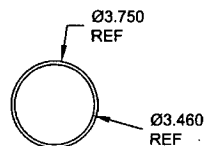


**SECTION A-A**  
SCALE 2X

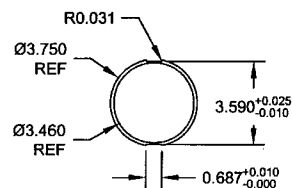

**SECTION B-B**  
SCALE 2X

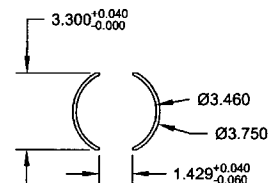

**SECTION C-C**  
SCALE 2X

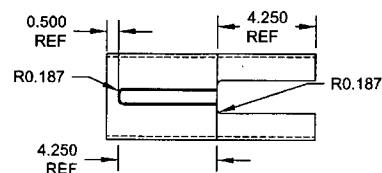


**VIEW Z-Z**  
SCALE 2X

**RELEASED**  
08-05-11

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AUS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE

WORK ORDER  
NO. 4700

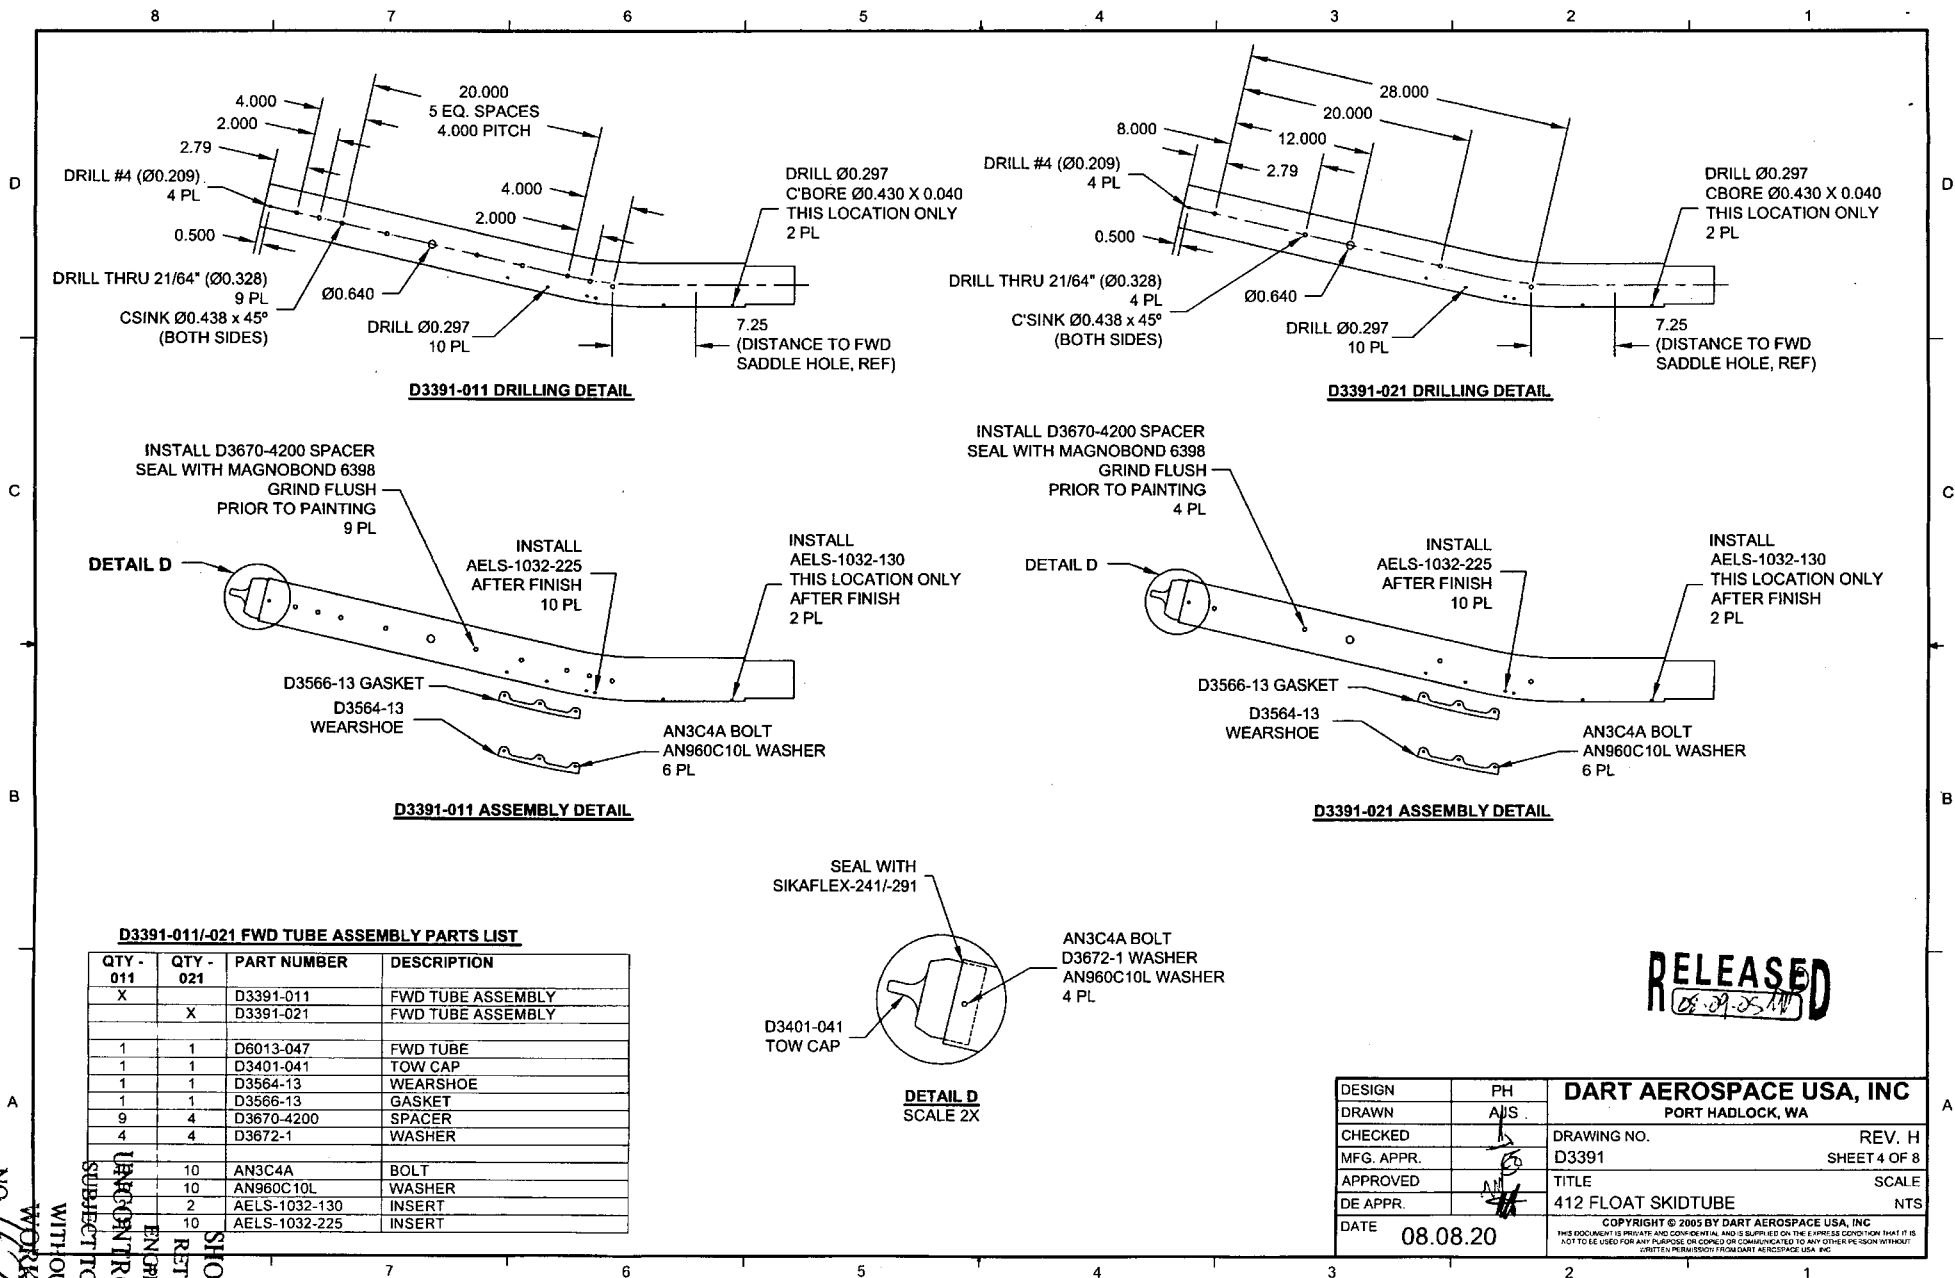


RELEASED


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUBJECT TO THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

NO. 42000  
 WORK ORDER  
 WITHOUT NOTICE  
 SUBJECT TO AMENDMENT  
 UNCONTROLLED COPY  
 ENGINEERING  
 RETURN TO  
 SHOP COPY





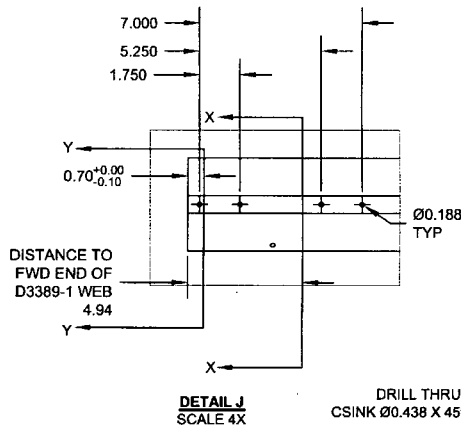


DRILL THRU 21/64" (Ø0.328)  
CSINK Ø0.438 X 45° (BOTH SIDES)  
12 PL

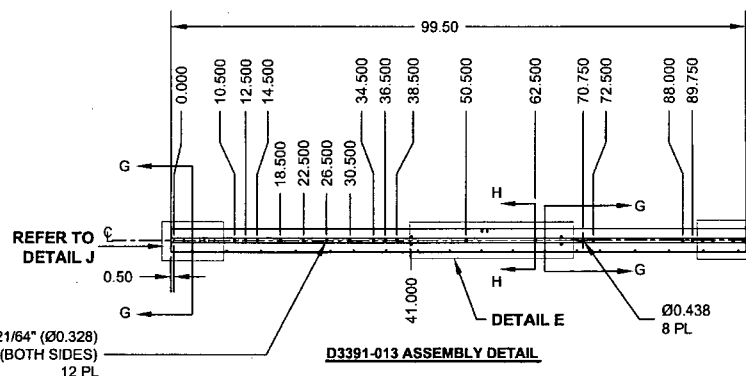

REFER TO  
DETAIL K

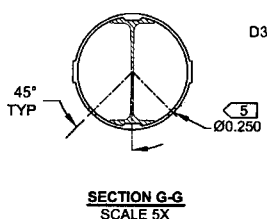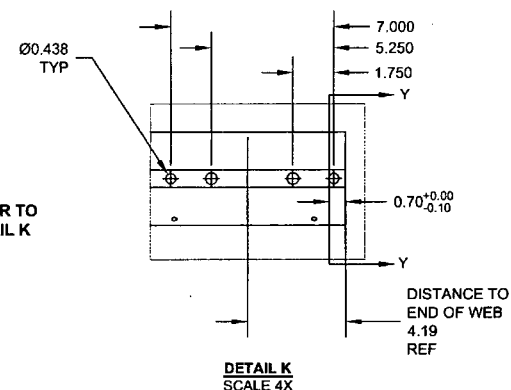

INSTALL  
D3681-1 SPACER

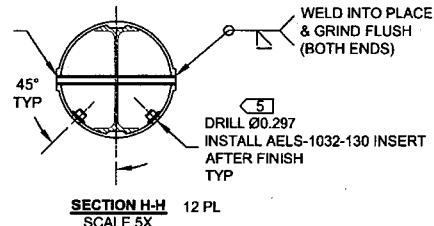


WELD INTO PLACE  
& GRIND FLUSH  
(BOTH ENDS)

DRILL Ø0.297  
INSTALL AELS-1032-130 INSERT  
AFTER FINISH  
TYP


REMOVE 0.030  
FROM TOP AND BOTTOM  
TO 3.610




REMOVE 0.225  
FROM TOP AND BOTTOM  
TO 3.800  
(0.7 FROM BOTH ENDS)

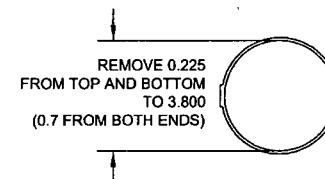

DRILL Ø0.297  
INSTALL AELS-1032-130 INSERT  
MS27039C1-09 SCREW  
D3672-1 WASHER  
AN960C10L WASHER  
AFTER FINISH  
4 PL

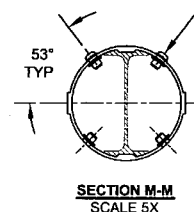


DRILL Ø0.250  
4 PL

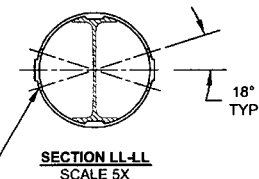


**RELEASED**

# **D3391-013 MID TUBE ASSEMBLY PARTS LIST**

QTY	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

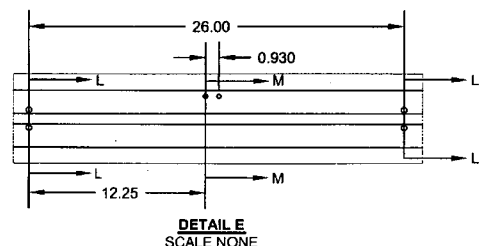


DRILL Ø0.391  
INSTALL ALS4-428-165 INSERT  
MS27039C4-08 SCREW  
D3672-3 WASHER  
AN960C416L WASHER  
AFTER FINISH  
4 PL

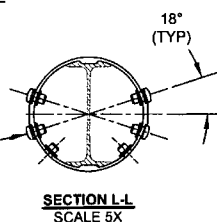


DESIGN	PH	<b>DART AEROSPACE USA, INC</b>
DRAWN	AJS	PORT HADLOCK, WA
CHECKED		DRAWING NO. REV. H
MFG. APPR.		D3391 SHEET 5 OF 8
APPROVED		TITLE SCALE
DE APPR.		412 FLOAT SKIDTUBE NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC


NO. 17000  
WORK ORDER  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
UNCHECKED COPY  
RETURN TO  
ENGINEERING  
FOR COPY

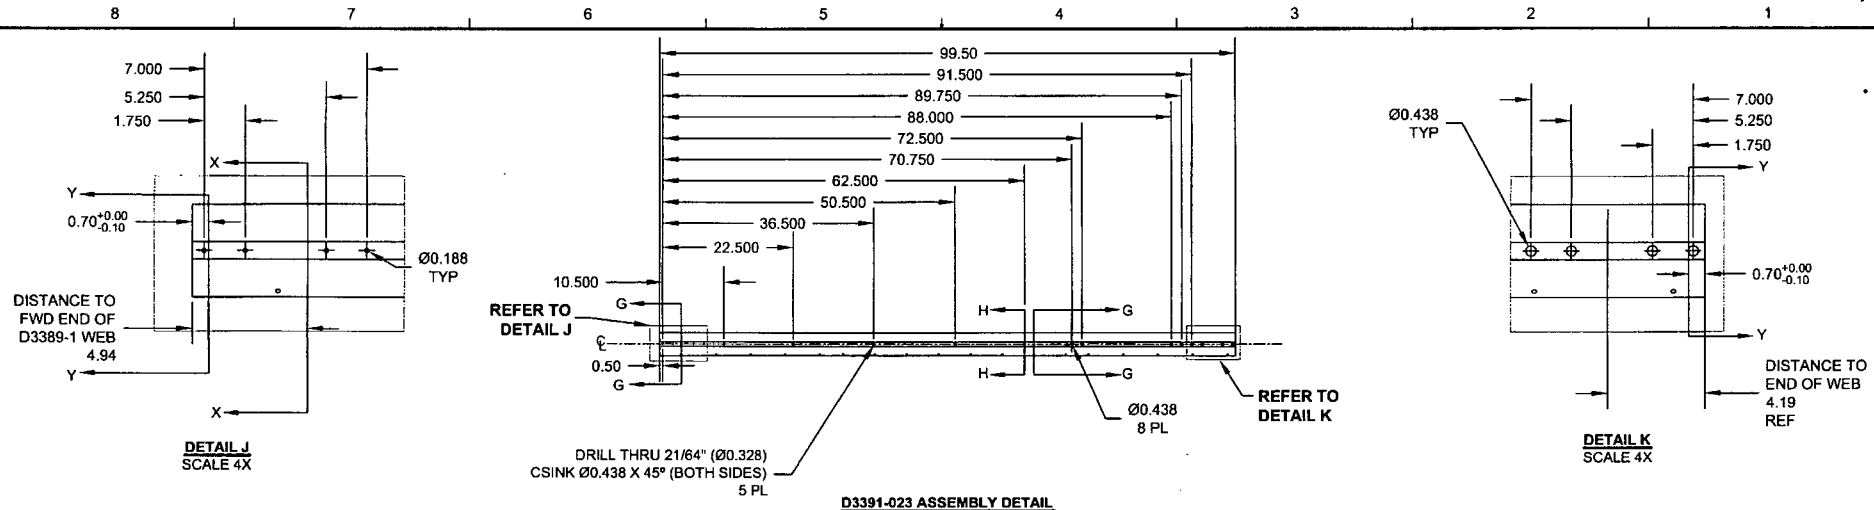


SECTION G-G  
SCALE 5X

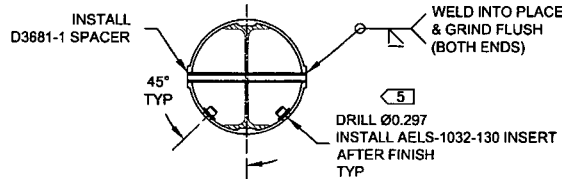

SECTION H-H  
SCALE 5X

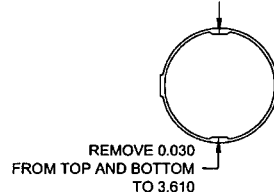

SECTION X-X  
SCALE 5X

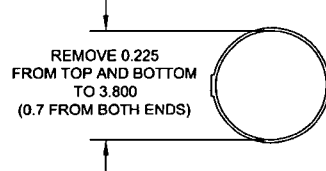

SECTION Y-Y  
SCALE 5X


D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY -	PART NUMBER	DESCRIPTION
023		
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

D3391-023 MID TUBE ASSEMBLY  
MATERIAL: MAKE FROM D2500-1-100 EXTRUSION  
INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015  
VERIFIED: FOR DART QSI 004


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 6 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

NO. 47006  
WORK ORDER  
WITHOUT NOTICE  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT

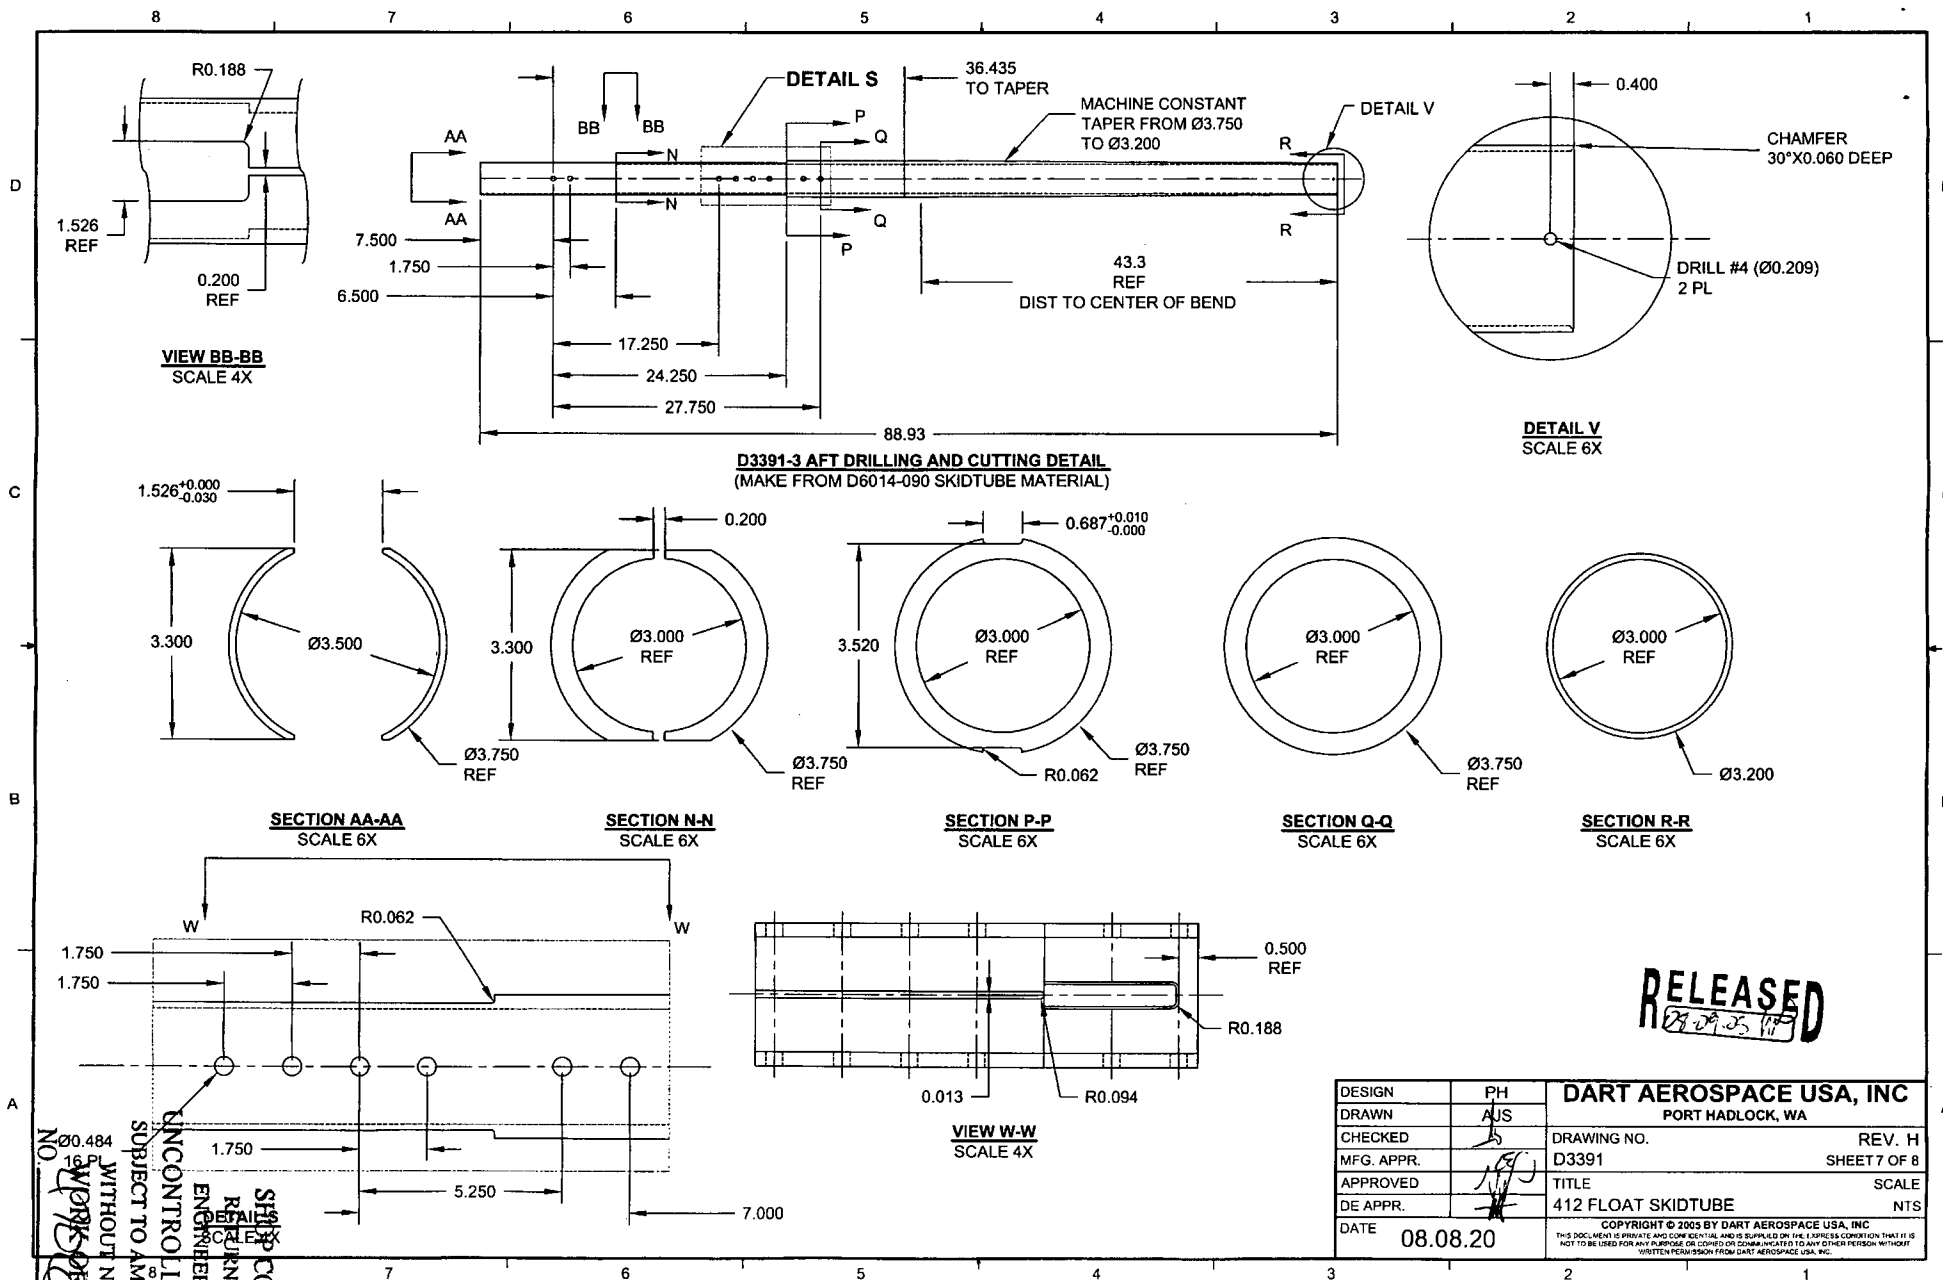


NO. 00.484  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
REPAIR COPY  
RETURN TO  
ENGINEERING  
DEPARTMENT


DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AUS	PORT HADLOCK, WA	
CHECKED	J	DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2003 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

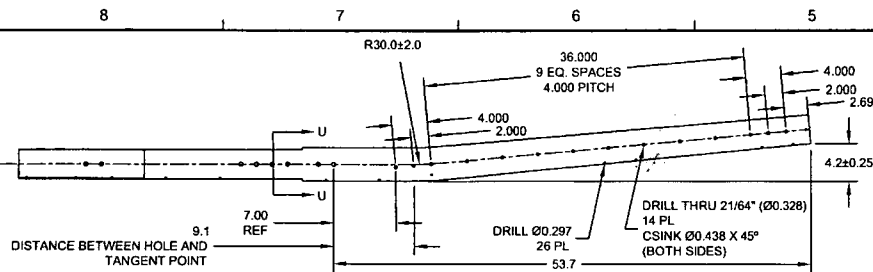


**D3391-015 BENDING AND DRILLING DETAIL**  
(SEE CBORE DETAIL BELOW)

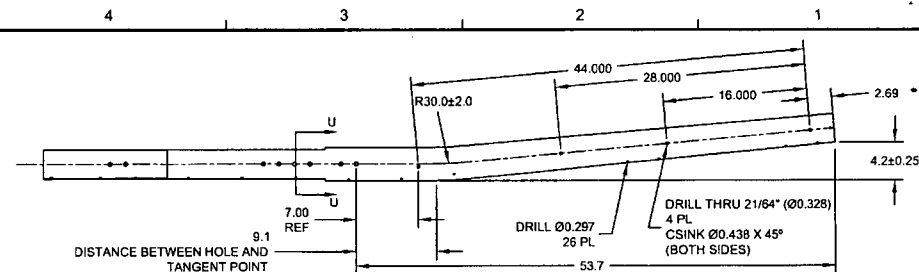

**D3391-025 BENDING AND DRILLING DETAIL**  
(SEE CBORE DETAIL BELOW)

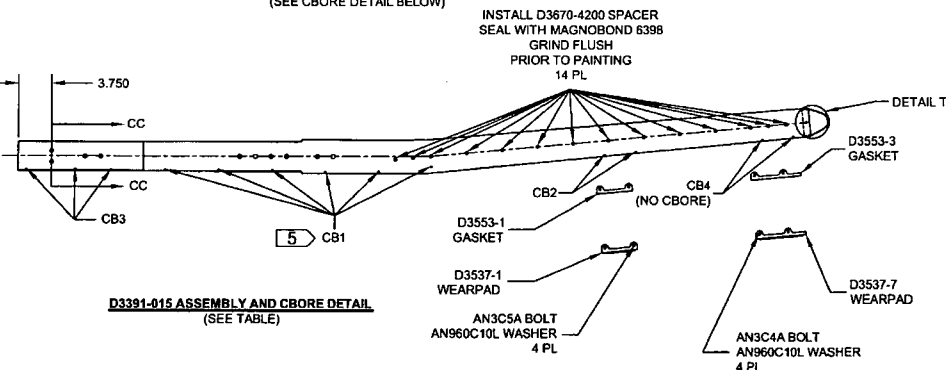


**D3391-015 ASSEMBLY AND CBORE DETAIL**  
(SEE TABLE)

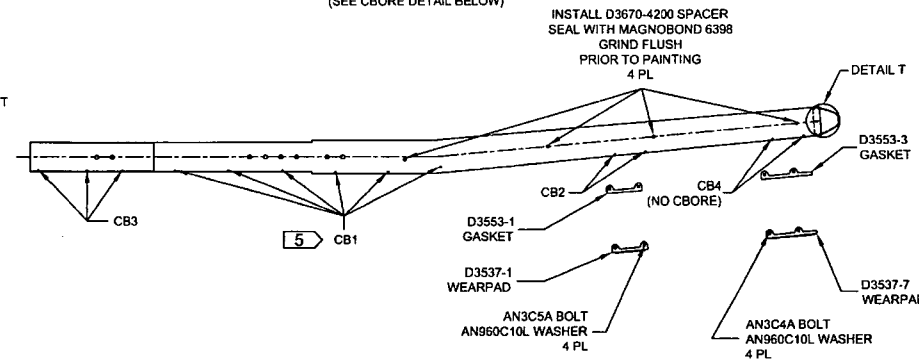


**D3391-025 ASSEMBLY AND CBORE DETAIL**  
(SEE TABLE)

**D3391-015-025 AFT TUBE ASSEMBLY PARTS LIST**

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X		D3391-015	AFT TUBE ASSEMBLY
	X	D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

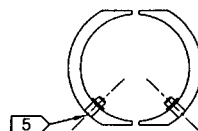


**SECTION U-U**  
SCALE 3X

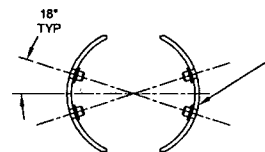

**SECTION CC-CC**  
SCALE 3X

DRILL Ø0.391  
CBORE Ø0.516 X 0.040 DEEP  
INSTALL ALS4-428-165 INSERT  
4 PL

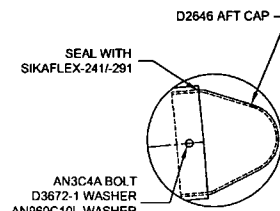

**DETAIL T**  
SCALE 4X

**RELEASED**  
08-09-05-137

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND  
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AS	PORT HADLOCK, WA	
CHECKED	h	DRAWING NO.	REV. H
MFG. APPR.	B	D3391	SHEET 8 OF 8
APPROVED	h	TITLE	SCALE
DE APPR.	h	412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2003 BY DART AEROSPACE USA, INC	

THIS DOCUMENT IS UNCLASSIFIED AND IS RELEASED ON THE 2-10-03 CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

NO. 47006  
WORK ORDER  
CONTROLLED COPY  
RETURN TO  
ENGINEERING  
FOR AMENDMENT  
WITHOUT NOTICE

NO. 188

**AWS D17.1.2001**  
**QUALIFICATION TEST RECORD**

Name: Barclay Elliot  
Job number: 43170  
Part number: 63391023  
Description: Mid tub  
Welding Process: Tig ☒ Mig ☐  
Base material: Aluminium  
Current: AC ☒ DC ☐

**TEST REQUIREMENTS AND RESULTS**

Visual: pass ☒ fail ☐  
Penetration: pass ☒ fail ☐

**UNACCEPTABLE**

Cracks: pass ☒ fail ☐  
Undercut: pass ☒ fail ☐  
Pin holes: pass ☒ fail ☐  
Overlap (cold lap): pass ☒ fail ☐  
Porosity (surface): pass ☒ fail ☐  
Coloration: pass ☒ fail ☐

Qualifier Pat Duval Date of Test Coupon 09-01-21

Welder Barclay Elliot Date of Test Coupon 09-01-21

The above named individual is qualified in accordance with AWS D17.1.2001 to weld